

AMENDMENT OF SOLICITATION


1. This contract shall cover structural repairs to DLA Buildings 404 and 505 only. All references and plans for Buildings 205, 206 and 406 shall be disregarded as they are NOT part of this contract. Plan sheets 2 of 26 through 9 of 26 shall be disregarded. Exception: Plan Sheet 7 of 26 'GIRDER ELEVATION' shall be used in conjunction with Detail C on plan sheet 25 of 26.
2. Submission of Invoices: NFAS clause 5252.232-9301 is no longer valid; the correct clause is DFARS 252.232-7006. This section shall be omitted and the Contract Specialist shall provide instructions for submitting invoices.
3. Replace Work Order Number 1158199 with Work Order Number 1172316. Work Order Number 1158199 is no longer valid and all references shall be replaced with Work Order Number 1172316.
4. Replace Building No. 404 Table on S-602 with table listed below:

| BUILDING NO. 404 | | | |
|-------------------------|---------------|---------------|---|
| MEMBER | DEFECT | DETAIL | COMMENTS |
| COLUMN | | | |
| B22 | SPLIT | A | CONFLICT #3 |
| B25 | BOLT MISSING | G | ADD (1) ADHESIVE ANCHOR |
| B27 | SPLIT | A | |
| C10 | DAMAGE | G | ADD NEW ANGLES/ADHESIVE ANCHORS |
| C14 | BOLT MISSING | G | ADD (1) ADHESIVE ANCHOR |
| C16 | SPLIT | A | ADD BOLTS FROM BASE TO SMOKE CURTAIN, CONFLICT: RADON TUBE |
| C18 | SPLIT | A | |
| H2 | SPLIT | A | |
| H7 | SPLIT | A | CONFLICT #3 |
| H9 | SPLIT | A | CONFLICT #3 |
| H11 | SPLIT | N/A | CONFLICT #3 H11: HAS CRACKS ON (2) SIDES, THEREFORE USE CLAMP PER "DETAIL E" IN AMENDMENT OF SOLICITATION #6 (Below) |
| GIRDER | | | |
| AB28 | SPLIT | C | CONFLICT #1, 3 & 9 |
| CD18 | SPLIT | C | CONFLICT #9 |
| GH04 | SPLIT | C | CONFLICT #12 |
| GH11 | SPLIT | C | |

5. Replace Building No. 505 Table on S-602 with table listed below:

| BUILDING NO. 505 | | | | |
|------------------|------------|--------|--------|-------------------------------|
| SHEET | MEMBER | DEFECT | DETAIL | COMMENTS |
| BRACING | | | | |
| S-406 | E/DX2[1] | SPLIT | - | REPLACE IN KIND |
| S-401 | C.3/DX60 | SPLIT | - | REPLACE IN KIND |
| S-401 | D.5/DX25 | SPLIT | - | REPLACE IN KIND |
| TRUSS | | | | |
| S-406 | B/B7[1] | SPLIT | L | EACH SIDE OF V25 |
| S-407 | B/B12[2] | SPLIT | L | EACH SIDE OF V48 |
| S-407 | B/D44[1,2] | SPLIT | - | REPLACE IN KIND |
| S-408 | D/B5[2] | SPLIT | L | NORTH SIDE OF V13 |
| S-407 | E/B12[2] | SPLIT | - | REPLACE IN KIND |
| S-407 | E/B15[1] | SPLIT | L | NORTH OF D57 AND SOUTH OF V57 |
| S-402 | 13/D21[2] | SPLIT | - | REPLACE IN KIND |
| S-402 | 17/D21[2] | SPLIT | - | REPLACE IN KIND |
| S-403 | 22/B1[1] | SPLIT | T | WEST OF D3 AND EAST OF D4 |
| S-403 | 26/B1[2] | SPLIT | T | NEAR END |
| S-401 | 28/D18[1] | SPLIT | T | BELOW TOP CHORD |

6. Alternate Column Repair Detail

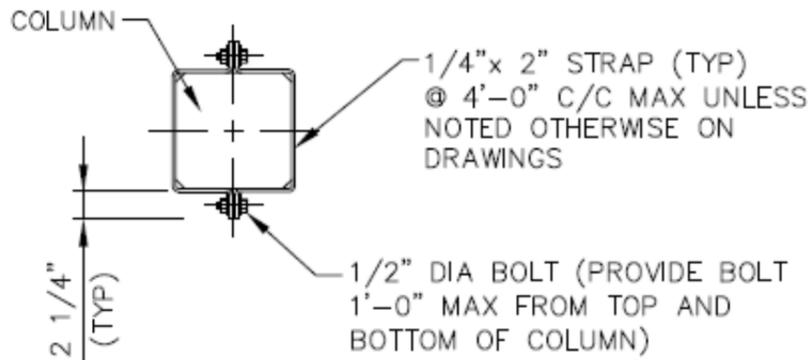

DETAIL E
NO SCALE

--- END ---